





512.810
512.809

MERCEDES-BENZ


MB100 - MB100D - MB120 - MB140 - MB160 - MB180

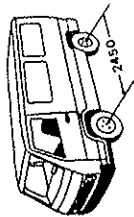


420-D-11 G

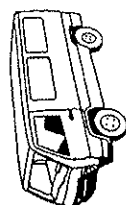


A

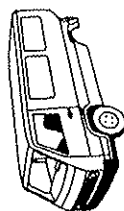


B

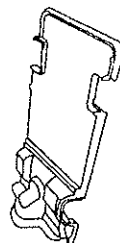

C




































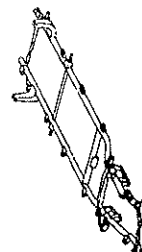


D

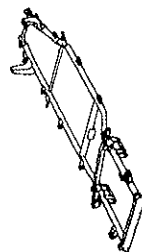

E

1 2 3 4 5 6 7 8 9

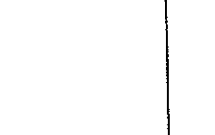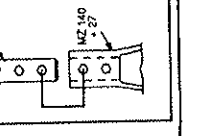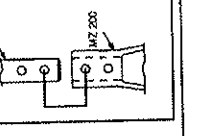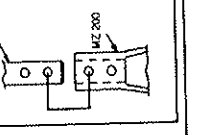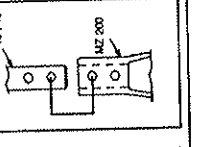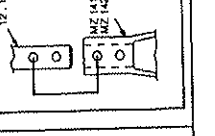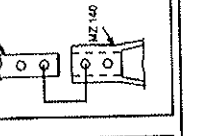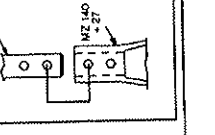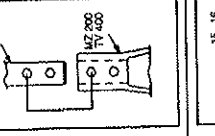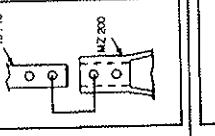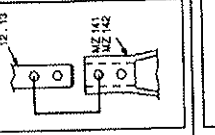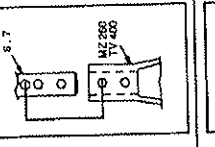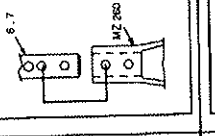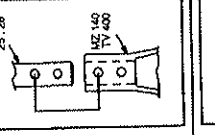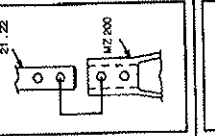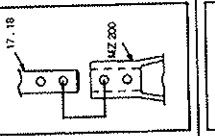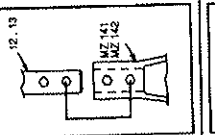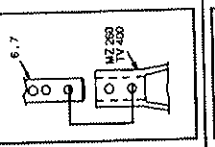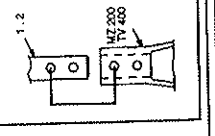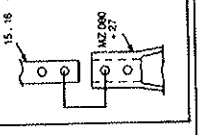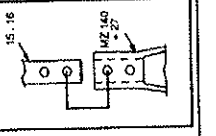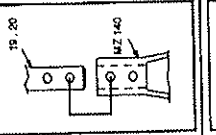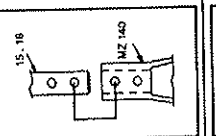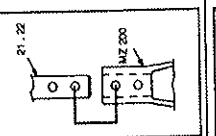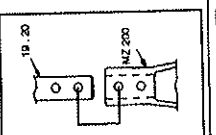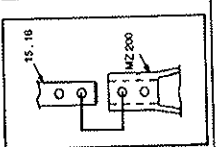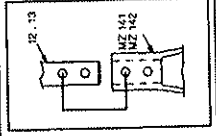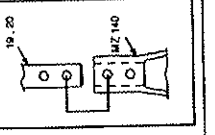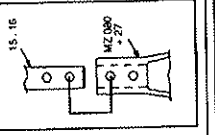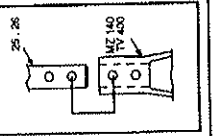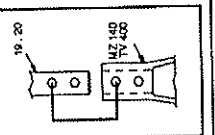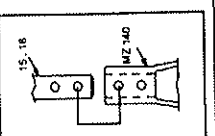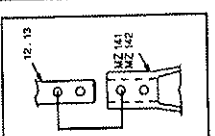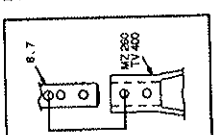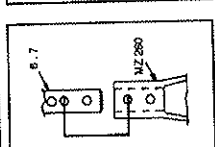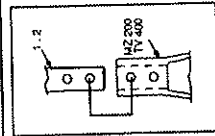




CELETTE®

MERCEDES-BENZ

MB100 - MB100D - MB120 - MB140 - MB160 - MB180

512.810
512.809

420-D-11H

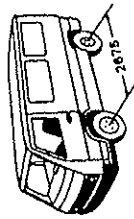

1

2

3


4

5


6

7


8

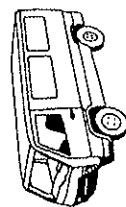


A

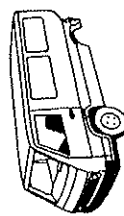


B

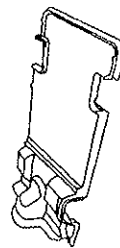


































C

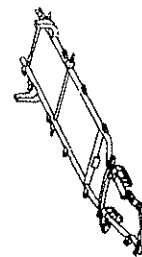

D

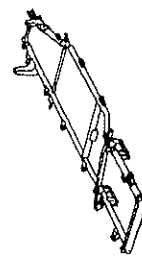


E

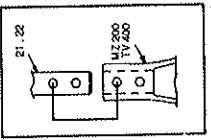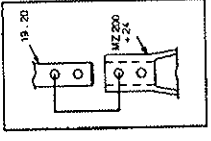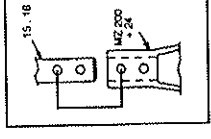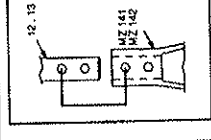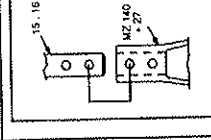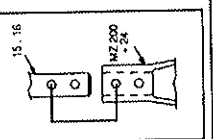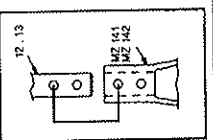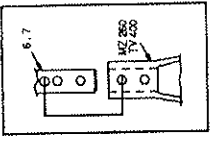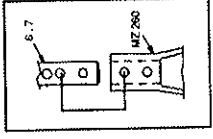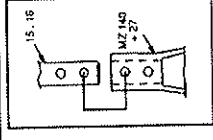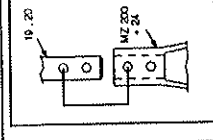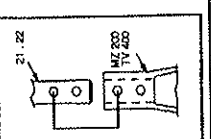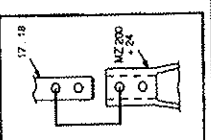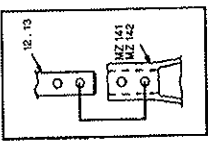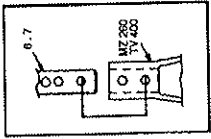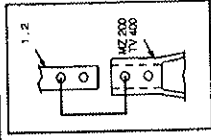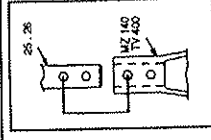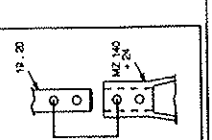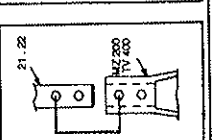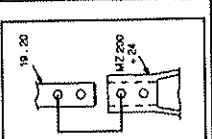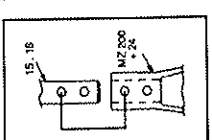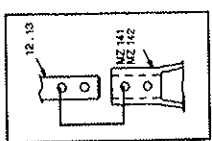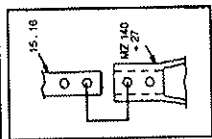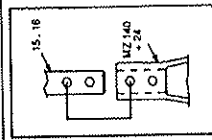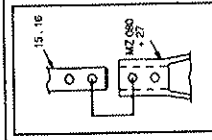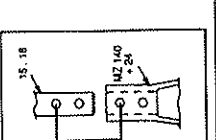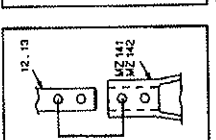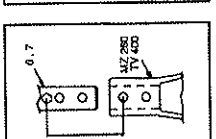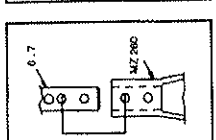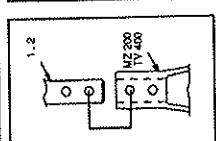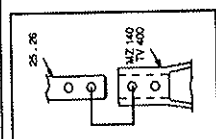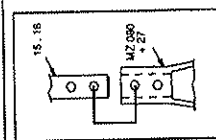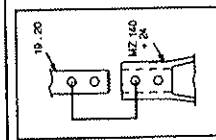

**CELETTE®****MERCEDES-BENZ****MB100 - MB100D - MB120 - MB140
MB160 - MB180**

Choc avant sur calase
Front crash on the car-body
Frontreparatur an Karosserie
Urto anteriore sulla scocca
Choque delantero sobre caja

Voir feuille 420-D-11G
See page (C 1-6)
Siehe Blatt
Vedere pagina 420-D-11H
Ver hoja (C 1-6)

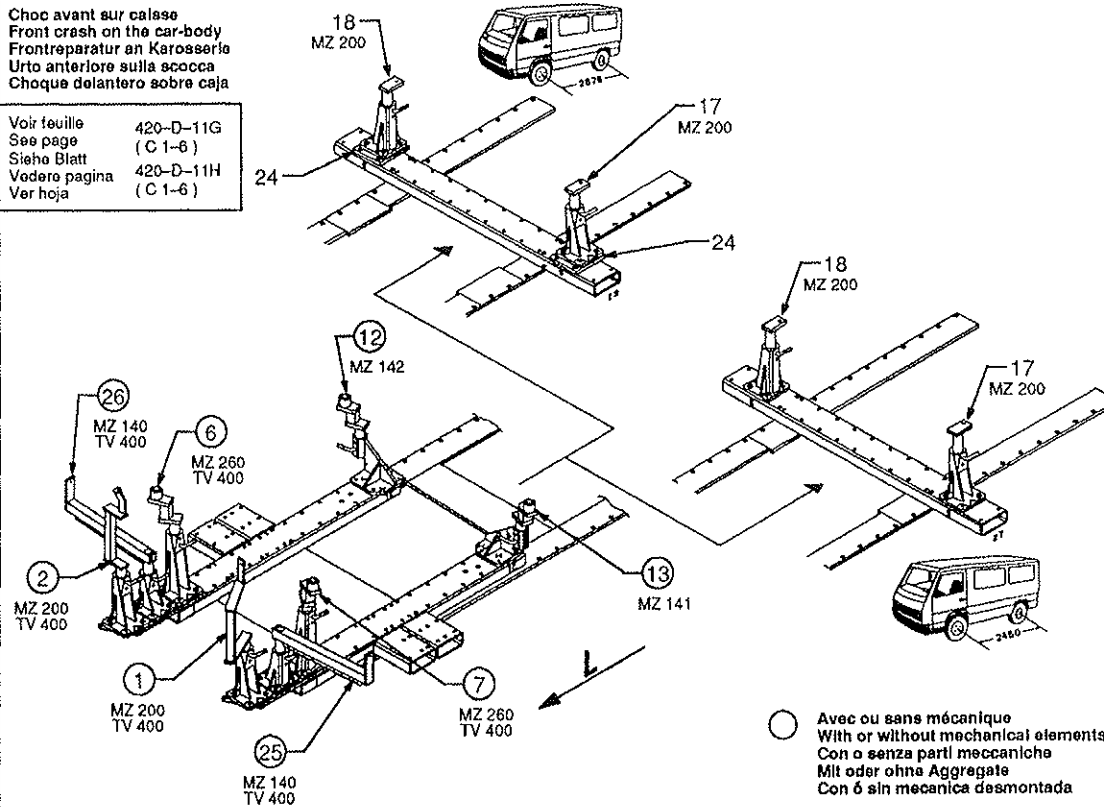



○ Avec ou sans mécanique
With or without mechanical elements
Con o senza parti meccaniche
Mit oder ohne Aggregate
Con ó sin mecánica desmontada

MERCEDES-BENZ

REP.	REFERENCE	POS	NB	MZ
1	512.701	3,5	1	
2	512.702	2,8	1	
3	512.703	3,5	1	
4	512.704	2,5	1	
5	512.705	1,4	1	
6	512.706	3,0	1	
7	512.707	3,0	1	
8	512.708	3,4	1	
9	512.709	3,4	1	
10	512.710	3,7	1	
11	512.711	3,7	1	
12	512.712	2,8	1	
13	512.713	2,8	1	
14	512.714	3,4	1	
15	512.715	3,2	1	
16	512.716	3,2	1	
17	512.717	2,1	1	
18	512.718	2,1	1	
19	512.719	3,2	1	
20	512.720	3,2	1	
21	512.721	1,7	1	
22	512.722	1,7	1	
23	512.723	0,5	2	
24	512.724	2,6	4	
25	512.725	5,1	1	
26	512.726	5,1	1	
27	512.727	3,8	2	
	V.58	0,1	4	
	MZ 080	3,0	2	
	MZ 080	3,0	2	
	MZ 140	4,0	5	
	MZ 140	4,0	2	
	MZ 200	5,0	6	
	MZ 260	6,0	3	
	MZ 141	7,0	1	
	MZ 142	7,0	1	
	TV 400	16,0	1	
	TV 400	16,0	1	

●	M 8x16	2
●	M 10x30	3
●	M 10x40	2
●	M 10x80	4
●	M 10x100	2
●	M 10x120	4
●	M 12x25	34
●	955.751	8
●	M 12x25	16
●	M 12x80	6
●	M 16x30	2
●	L. 12	6


512.810	
● 512.809	
230 Kg	29.01.90 420-D-11 i

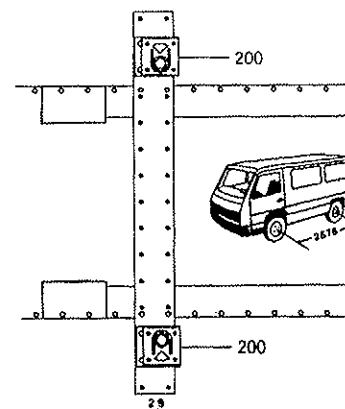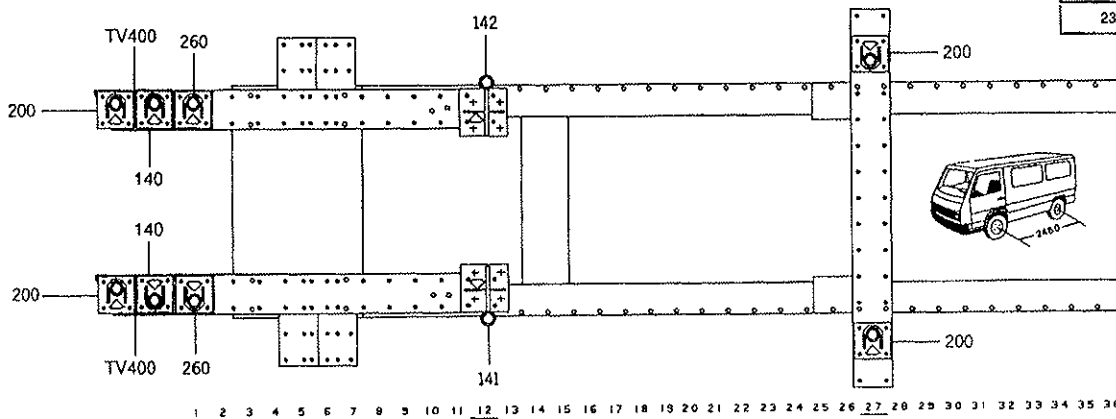**CELETTE®**
VENNIE-FRANCE

© Copyright 1990 CELETTE S.A. - All rights reserved. No part of this document may be reproduced in any form, by photostat, xerography or any other means, or incorporated into any informational retrieval system, electronic or mechanical, without the permission of the copyright owner.

Choc arrière sur caisse
Rear crash on car-body
Heckreparatur an Karosserie
Urto posteriore sulla scocca
Choque trasero sobre caja

Voir feuille 420-D-11G
See page (C 1-6)
Siehe Blatt 420-D-11H
Vedere pagina (C 1-6)
Ver hoja

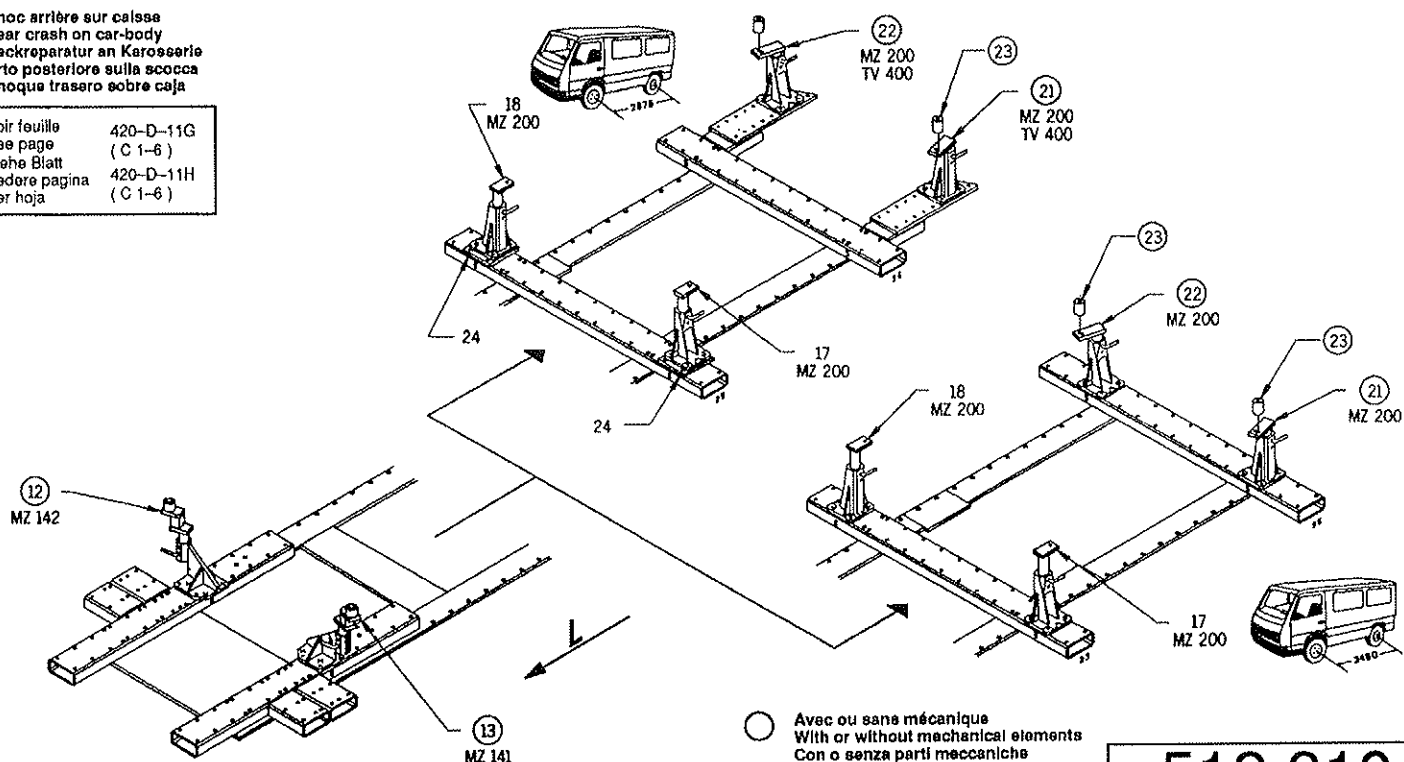

○ Avec ou sans mécanique
With or without mechanical elements
Con o senza parti meccaniche
Mit oder ohne Aggregate
Con ó sin mecánica desmontada

MERCEDES-BENZ

512.810
● 512.809

230 Kg 29.01.90 420-D-11 J




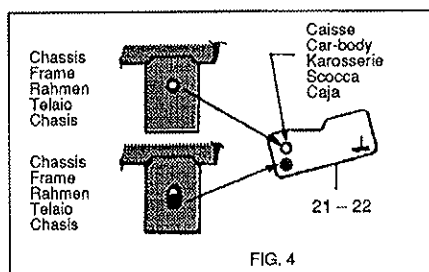




FIG. 4

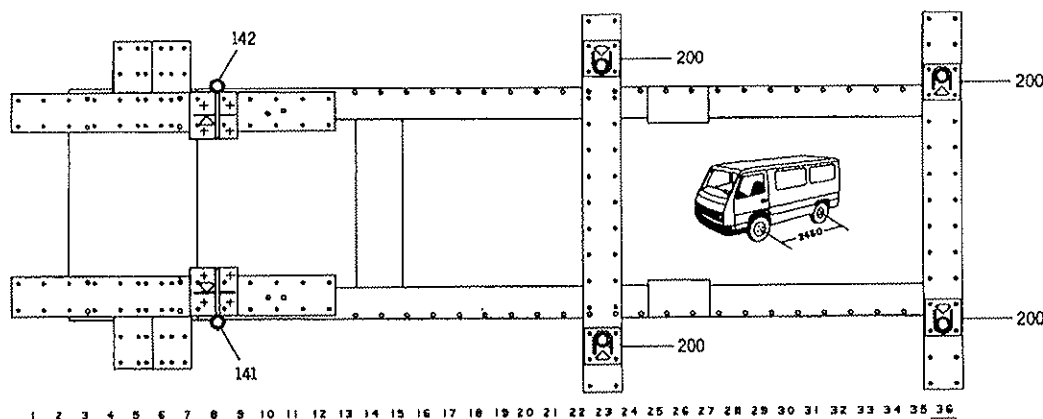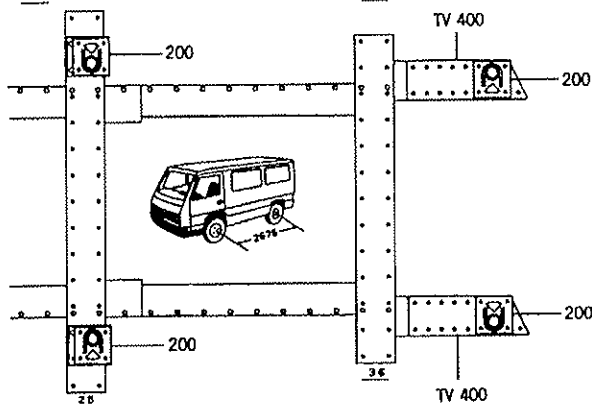

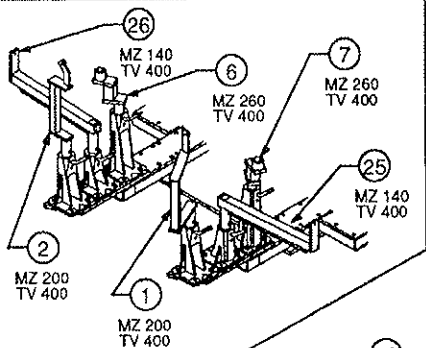

Choc avant sur chassis ou chassis plus caisse
Front crash on the frame or frame + car-body
Frontreparatur am Rahmen oder am kompletten Fahrzeug
Urto anteriore sul telaio + scocca
Choque delantero sobre chasis o chasis + caja

Voir feuille 420-D-11G
See page (A 1-9 oder D 1-7)
Siehe Blatt 420-D-11H
Vedere pagina (A 1-8 oder D 1-6)
Ver hoja

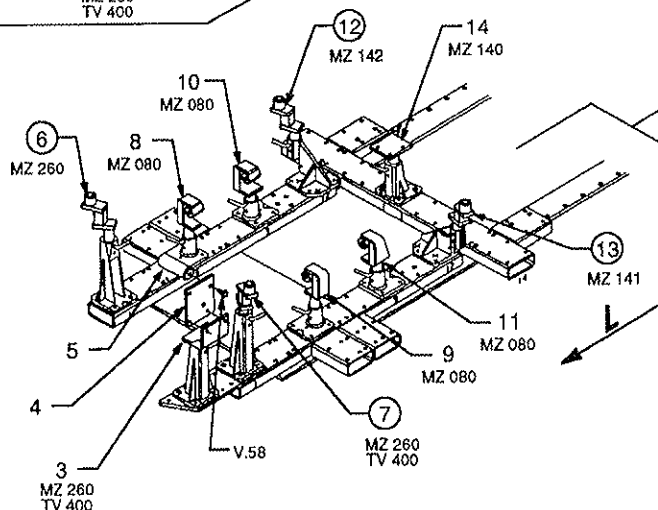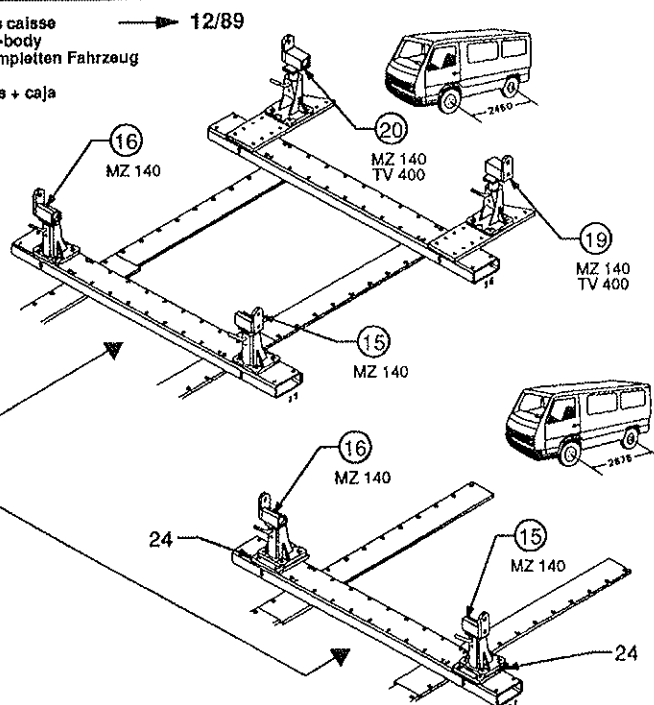

○ Avec ou sans mécanique
With or without mechanical elements
Con o senza parti meccaniche
Mit oder ohne Aggregate
Con ó sin mecanica desmontada

MERCEDES-BENZ

512.810
● 512.809
230 Kg 29.01.90 420-D-11 K

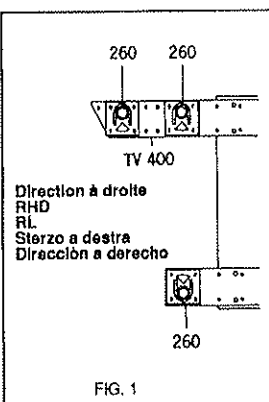
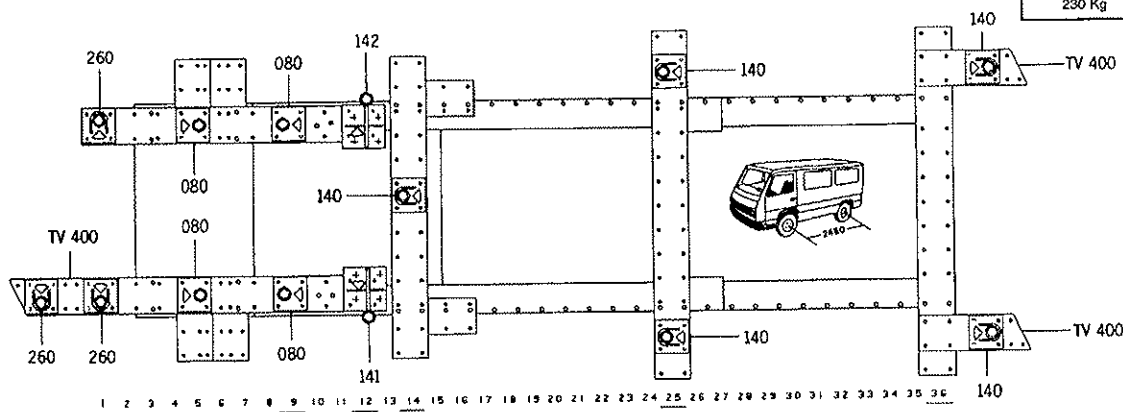


FIG. 1

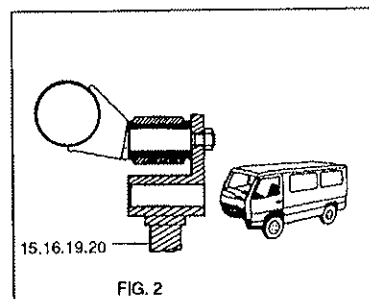
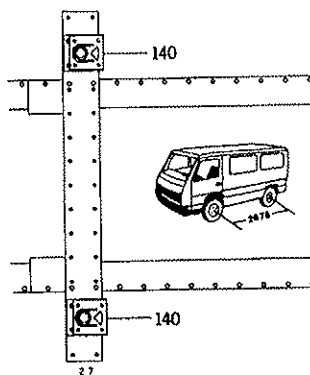
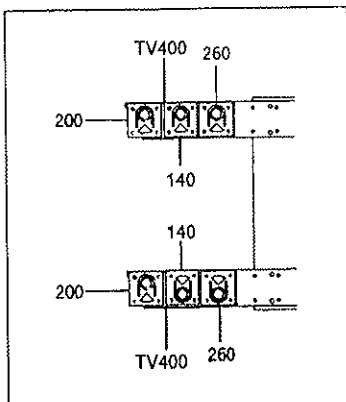





FIG. 2

A partir du N° de châssis57303.
Ab chassis N°57303.

12/89 →

Choc avant sur châssis ou châssis plus caisse
Front crash on the frame or frame + car-body
Frontreparatur am Rahmen oder am kompletten Fahrzeug
Urto anterloro sul telaio + scocca
Choque delantero sobre chasis o chasis + caja

Voir feuille 420-D-11G
See page (A 1-9 oder D 1-7)
Siehe Blatt 420-D-11H
Vedere pagina (A 1-8 oder D 1-6)
Ver hoja

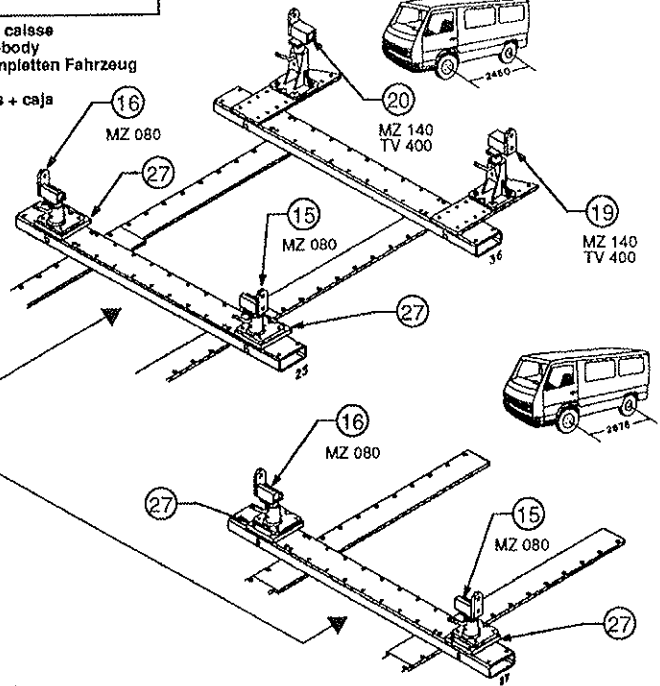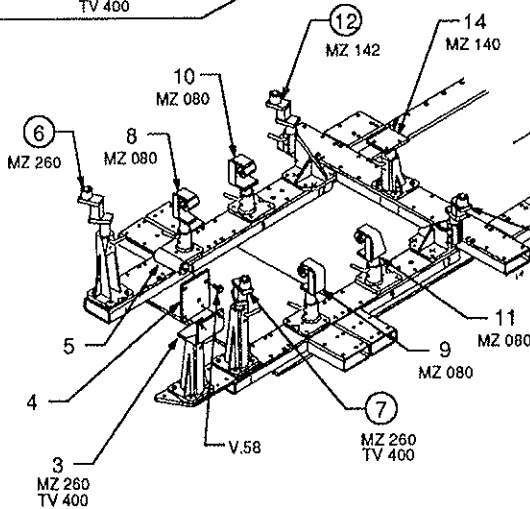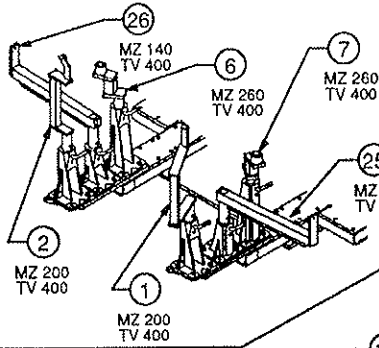

○ Avec ou sans mécanique
With or without mechanical elements
Con o senza parti meccaniche
Mit oder ohne Aggregate
Con ó sin mecánica desmontada

MERCEDES-BENZ

512.810

● 512.809

230 Kg 29.01.90 420-D-11 L

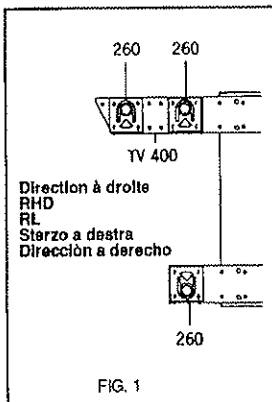
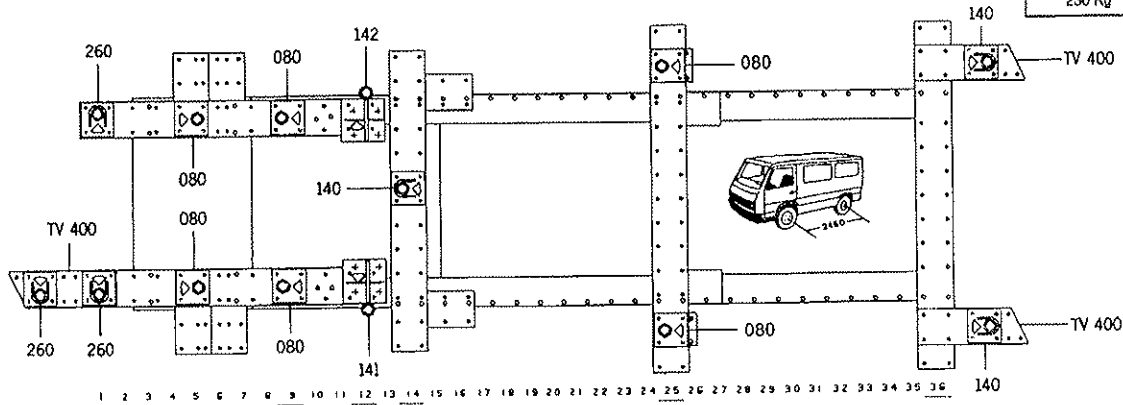


FIG. 1




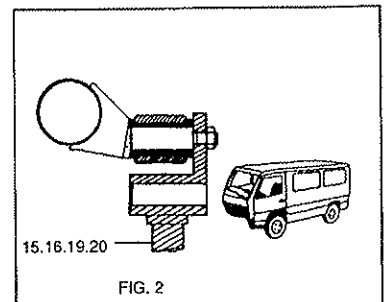


FIG. 2

**CELETTE®****MERCEDES-BENZ****MB100 - MB100D - MB120 - MB140
MB160 - MB180**

Léger choc arrière avec mécanique arrière
 Light rear crash with rear mechanical units in place
 Leichter Heckshaden bei eingebaute Aggregate (hinten)
 Urto posteriore leggero con meccanica posteriore
 Legero choque trasero con mecanica trasera montada

Voir feuille
 See page
 Siehe Blatt
 Vedere pagina
 Ver hoja

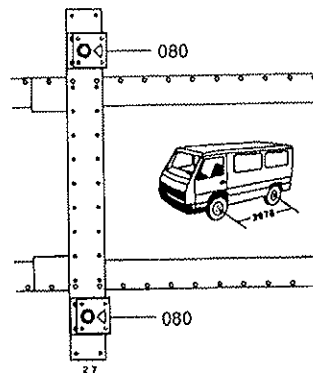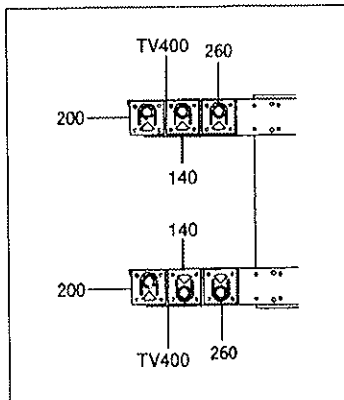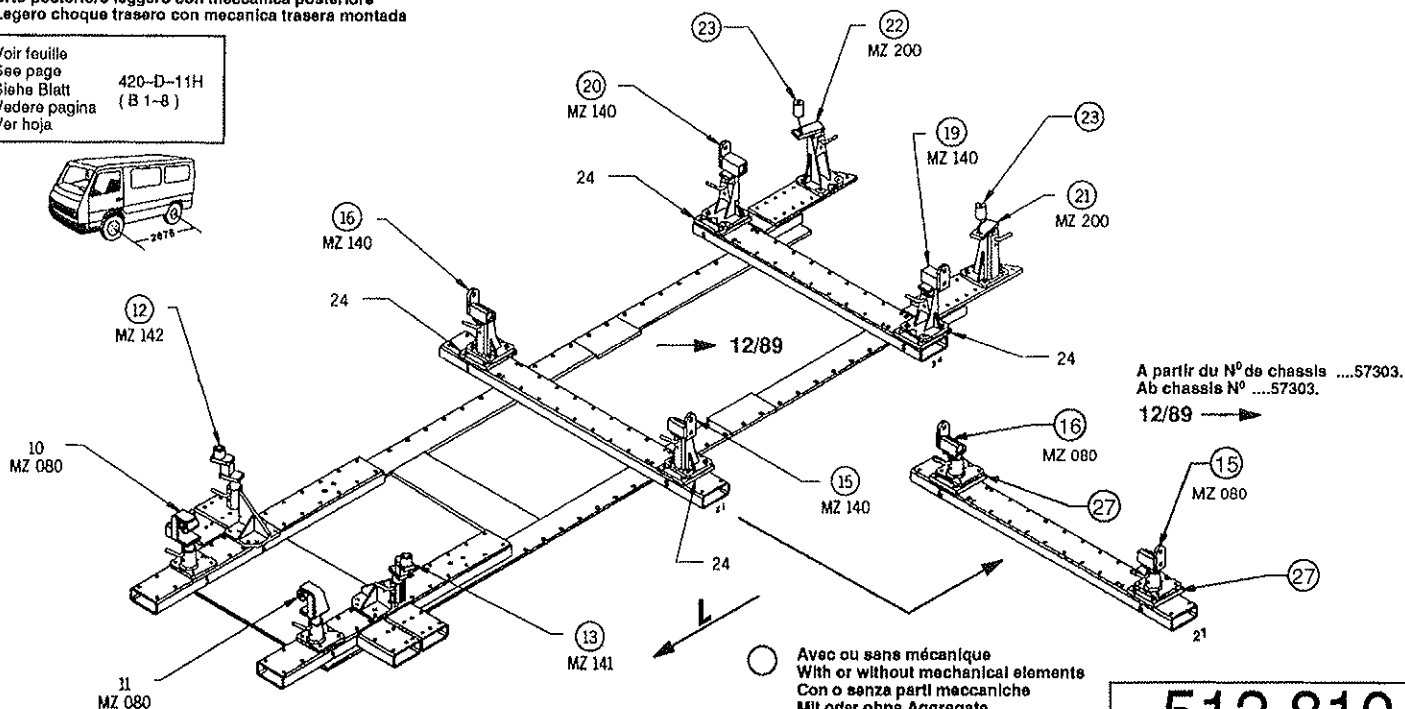

○ Avec ou sans mécanique
 With or without mechanical elements
 Con o senza parti meccaniche
 Mit oder ohne Aggregate
 Con ó sin mecanica desmontada

MERCEDES-BENZ

A partir du N° de chassis57303.
 Ab chassis N°57303.

12/89 →

512.810**• 512.809**

230 Kg	29.01.90	420-D-11 M
--------	----------	------------

Léger choc arrière avec mécanique arrière
 Light rear crash with rear mechanical units in place
 Leichter Heckshaden bei eingebaute Aggregate (hinten)
 Urto posteriore leggero con meccanica posteriore
 Legero choque trasero con mecanica trasera montada

Voir feuille
 See page
 Siehe Blatt
 Vedere pagina
 Ver hoja

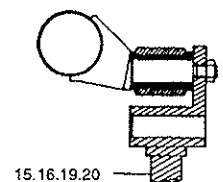
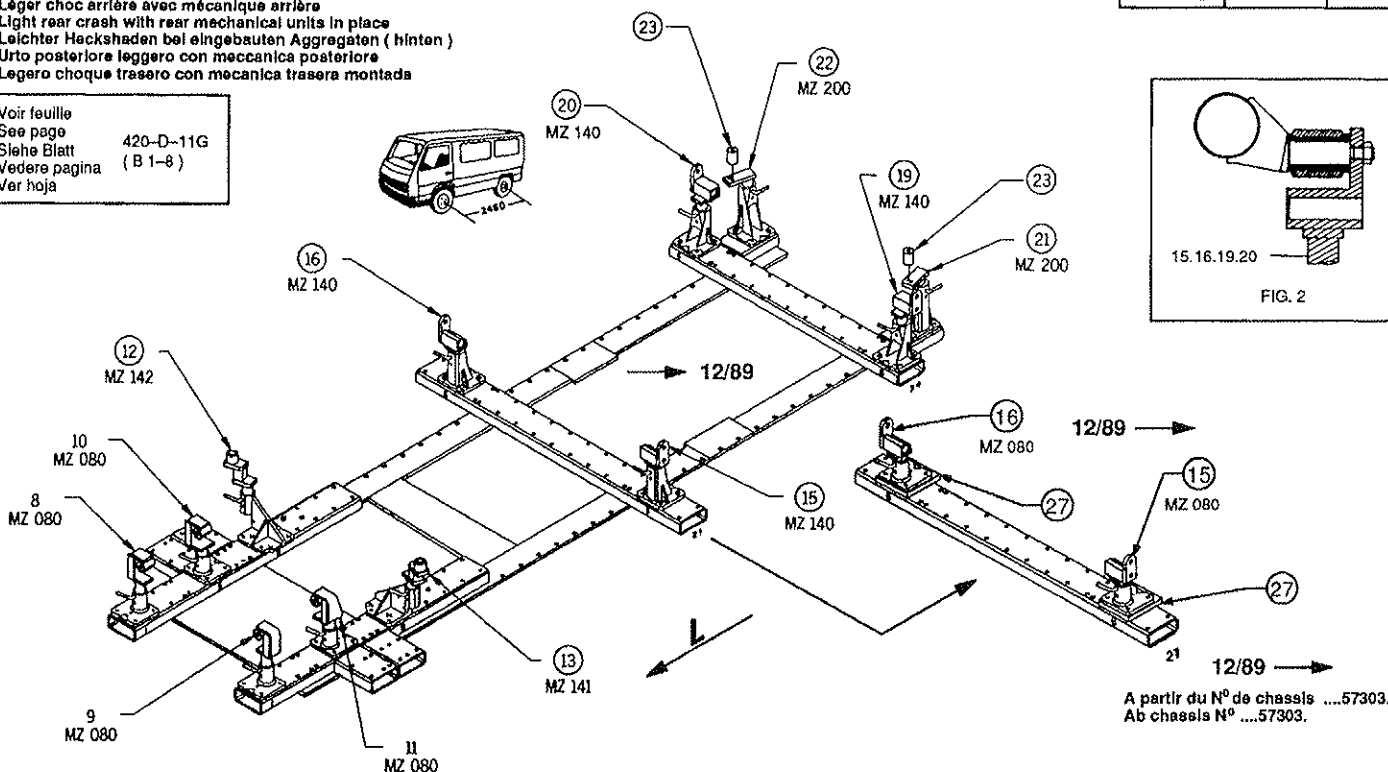


FIG. 2

A partir du N° de chassis57303.
 Ab chassis N°57303.


CELETTE®
VERRE-FRANCE

© Copyright 1990 CELETTE S.A. - All rights reserved. No part of this document may be reproduced in any form, by photostat, xerography or any other means, or incorporated into any informational retrieval system, electronic or mechanical, without the permission of the copyright owner.

**CELETTE®****MERCEDES-BENZ****MB100 - MB100D - MB120 - MB140
MB160 - MB180**

Choc arrière sur châssis ou châssis plus caisse
 Rear crash on the frame or frame + car-body
 Heckreparatur am Rahmen oder am Kompletten Fahrzeug
 Urto posteriore sul telaio o telaio + scocca
 Choque trasero sobre chasis o chasis + caja

Voir feuille
 See page
 Siehe Blatt
 Vedere pagina
 Ver hoja

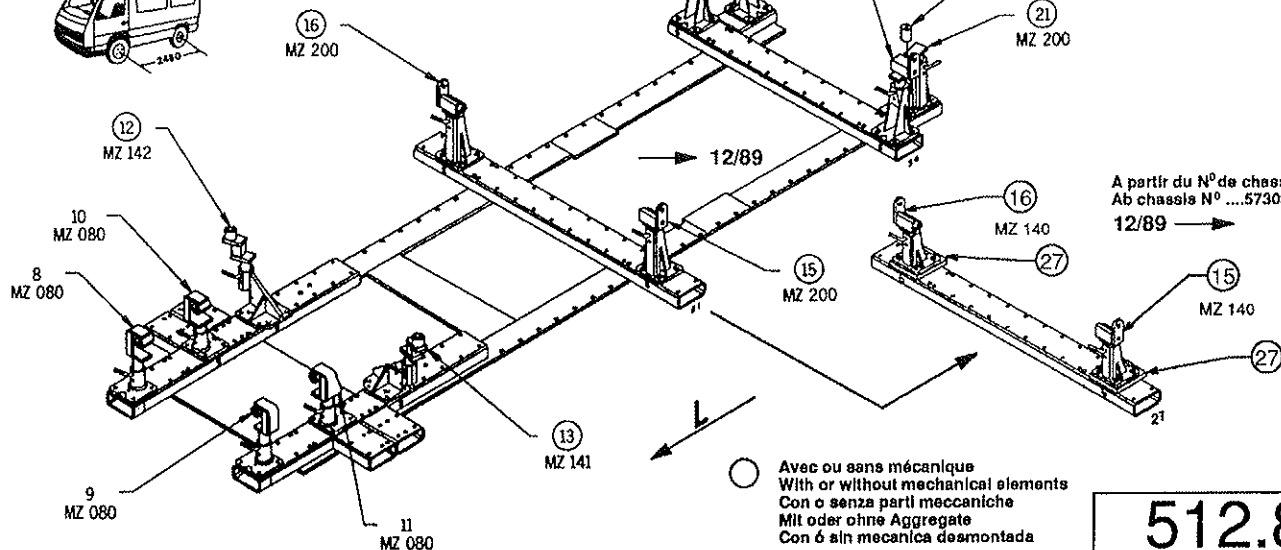

A partir du N° de chasis57303.
 Ab chasis N°57303.

12/89 →

○ Avec ou sans mécanique
 With or without mechanical elements
 Con o senza parti meccaniche
 Mit oder ohne Aggregate
 Con ó sin mecanica desmontada

MERCEDES-BENZ**512.810****• 512.809**

230 Kg	29.01.90	420-D-11 N
--------	----------	------------

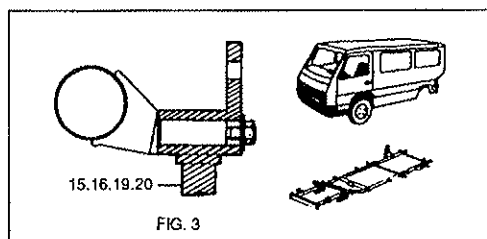
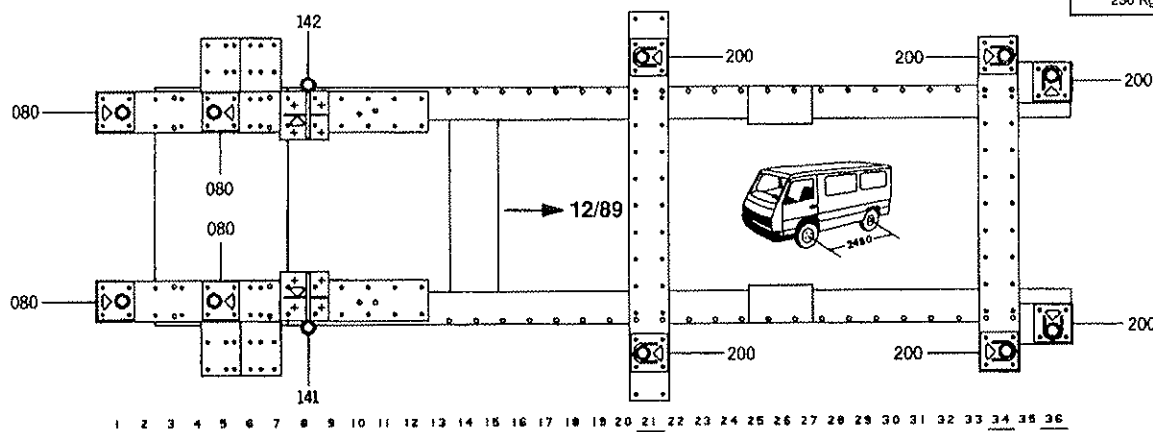


FIG. 3

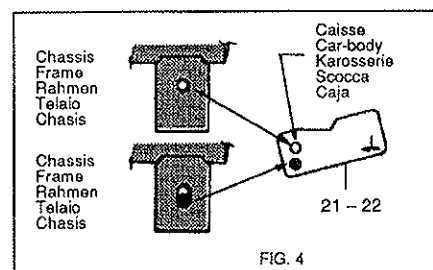
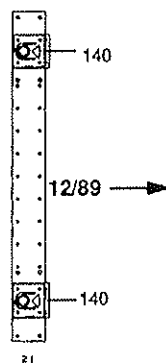


FIG. 4

CELETTE®
VIENNE-FRANCE


© Copyright 1990 CELETTE S.A. - All rights reserved. No part of this document may be reproduced in any form, by photostat, xerography or any other means, or incorporated into any Informational retrieval system, electronic or mechanical, without the permission of the copyright owner.

**CELETTE®****MERCEDES-BENZ****MB100 - MB100D - MB120 - MB140
MB160 - MB180**

Choc arrière sur châssis ou châssis plus caisse
 Rear crash on the frame or frame + car-body
 Heckreparatur am Rahmen oder am Kompletten Fahrzeug
 Urto posteriore sul telaio o telaio + scocca
 Choque trasero sobre chasis o chasis + caja

Voir feuille
 See page
 Siehe Blatt
 Vedere pagina
 Ver hoja

420-D-11H
 (B 1-8 oder E 1-5)




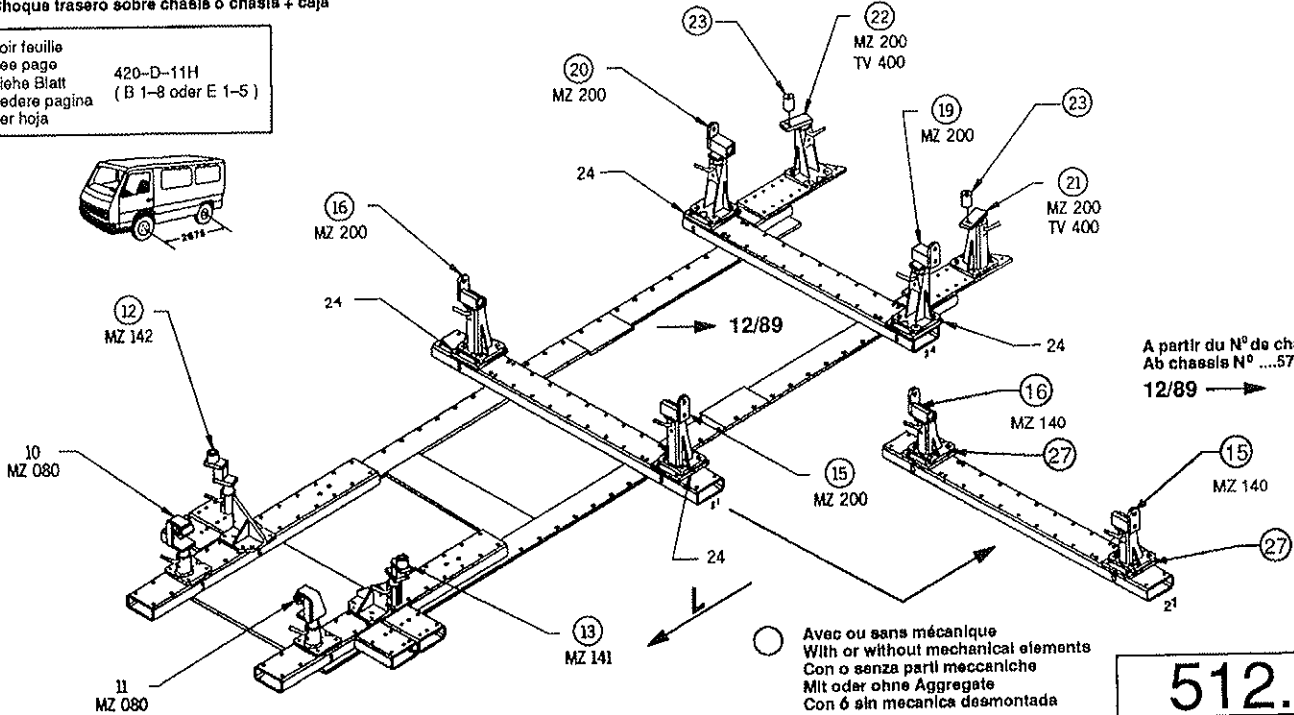


A partir du N° de chassis57303.
 Ab chassis N°57303.
 12/89 →

○ Avec ou sans mécanique
 With or without mechanical elements
 Con o senza parti meccaniche
 Mit oder ohne Aggregate
 Con ó sin mecánica desmontada

MERCEDES-BENZ**512.810****• 512.809**

230 Kg	29.01.90	420-D-11 ○
--------	----------	------------

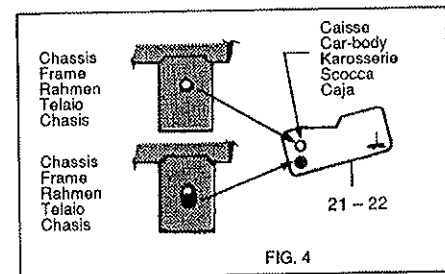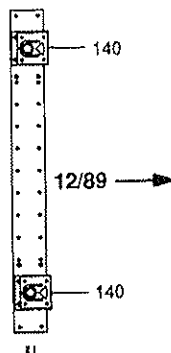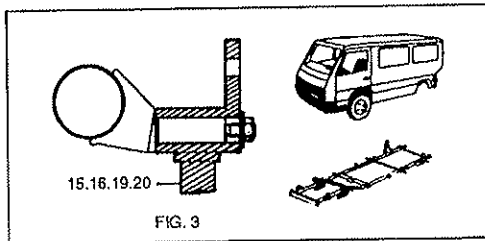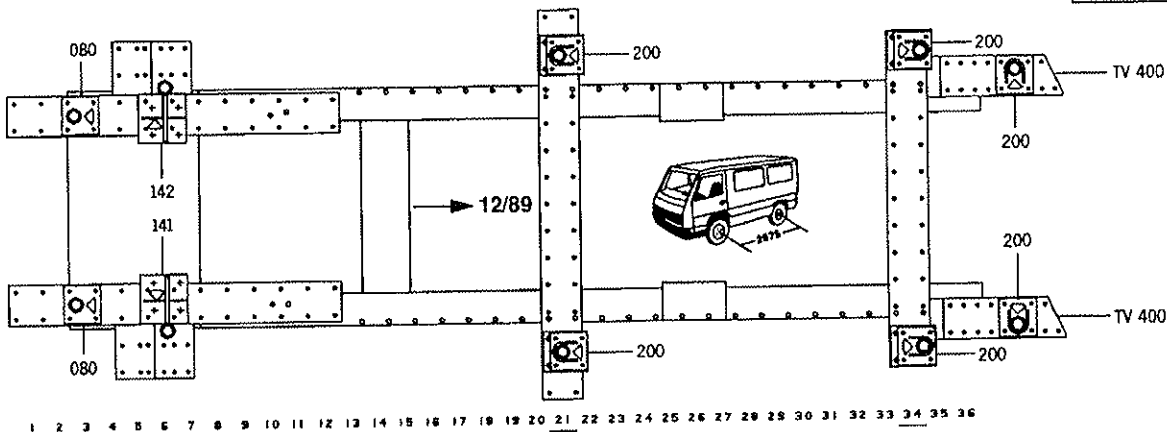
**CELETTE®**
WIENNE-FRANCE

© Copyright 1990 CELETTE S.A. - All rights reserved. No part of this document may be reproduced in any form, by photostat, xerography or any other means, or incorporated into any informational retrieval system, electronic or mechanical, without the permission of the copyright owner.

**CELETTE®****MERCEDES-BENZ****MB100 - MB100D - MB120 - MB140
MB160 - MB180**

Choc avant sur caisse
Front crash on the car-body
Frontreparatur an Karosserie
Urto anteriore sulla scocca
Choque delantero sobre caja

Voir feuille 420-D-11G
See page (C 1-6)
Siehe Blatt
Vedere pagina 420-D-11H
Ver hoja (C 1-8)

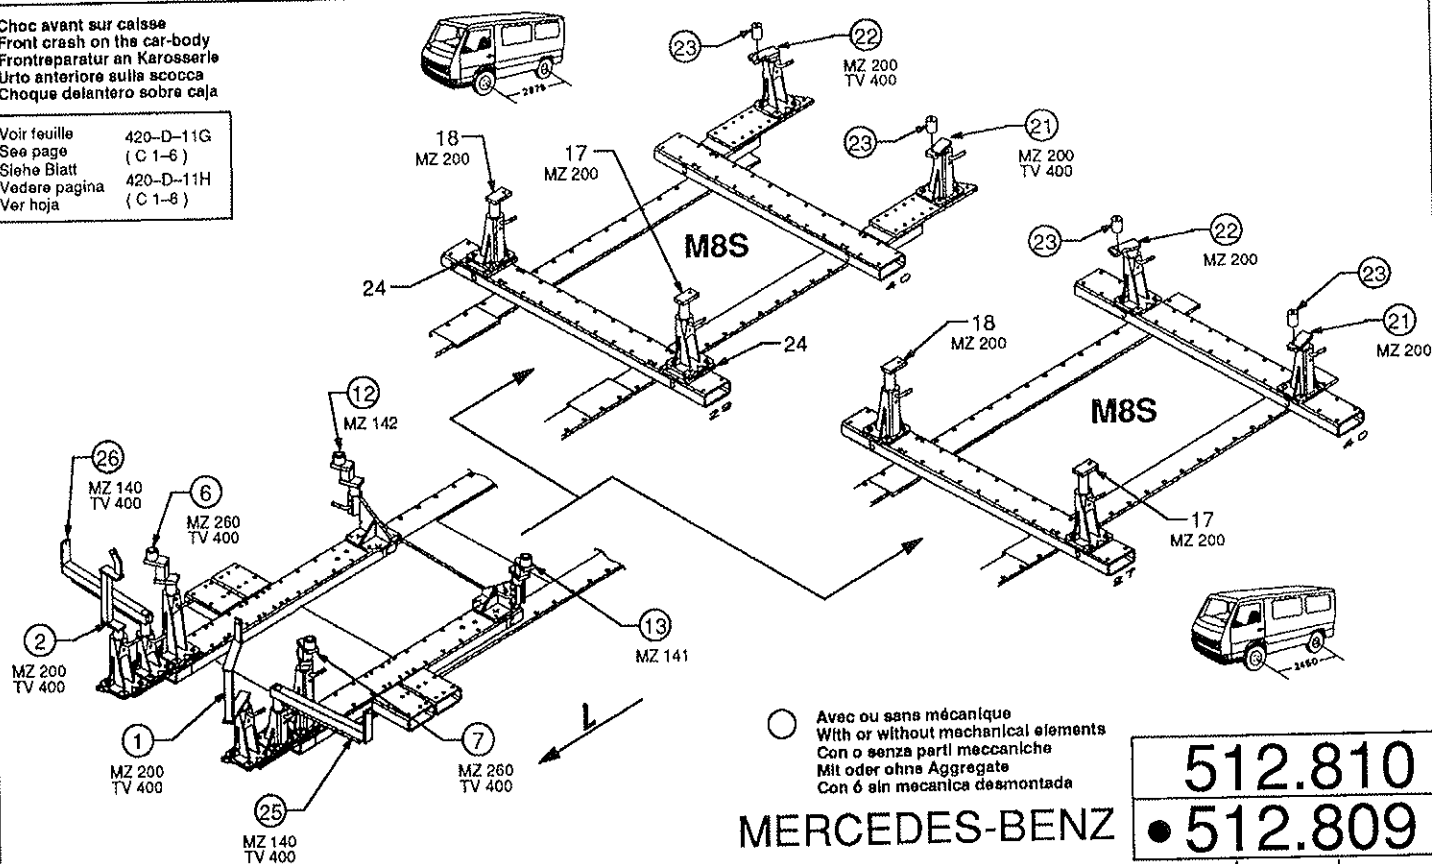

○ Avec ou sans mécanique
With or without mechanical elements
Con o senza parti meccaniche
Mit oder ohne Aggregate
Con ó sin mecánica desmontada


MERCEDES-BENZ

512.810
• 512.809

230 Kg 29.01.90 420-D-11 P


Choc arrière sur caisse
Rear crash on car-body
Heckreparatur an Karosserie
Urto posteriore sulla scocca
Choque trasero sobre caja

Voir feuille 420-D-11G
See page (C 1-6)
Siehe Blatt
Vedere pagina 420-D-11H
Ver hoja (C 1-6)

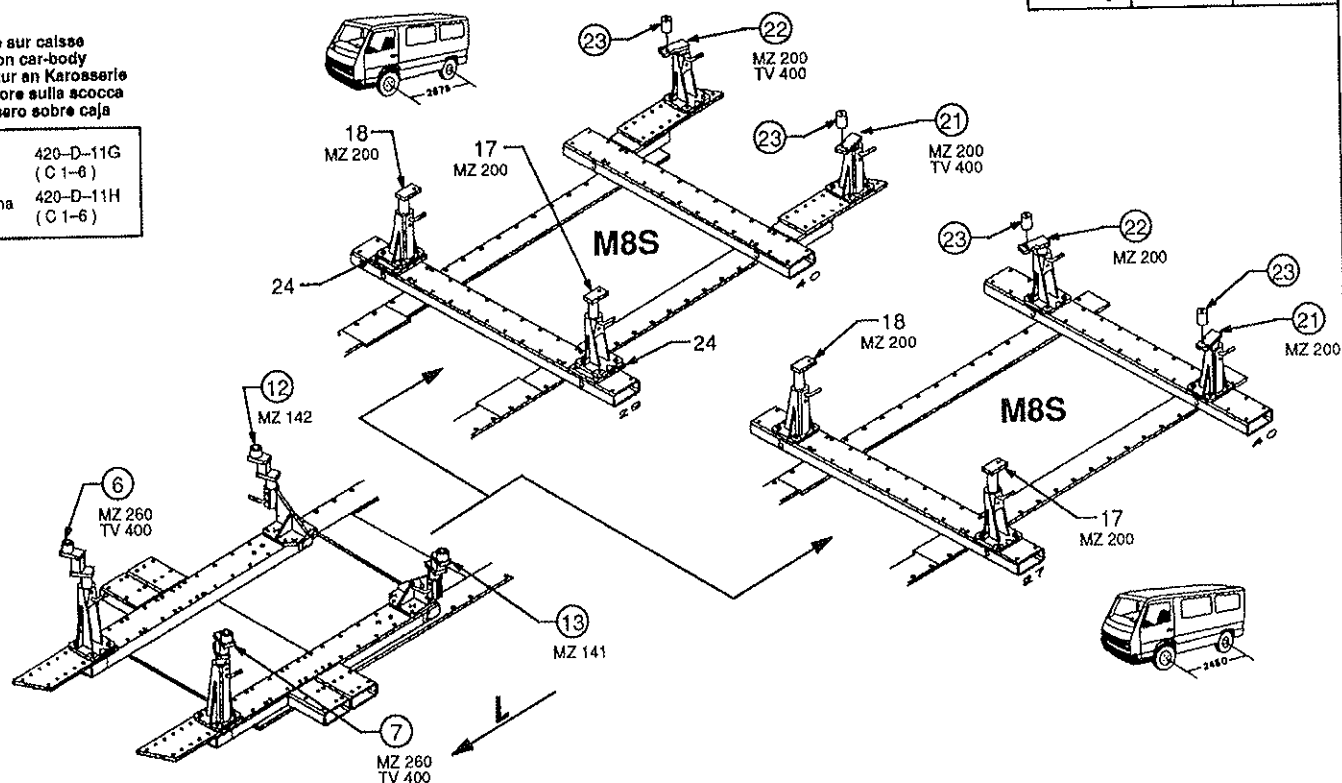


CELETTE®
WIENNE-FRANCE

© Copyright 1990 CELETTE S.A. - All rights reserved. No part of this document may be reproduced in any form, by photostat, xerography or any other means, or incorporated into any informational retrieval system, electronic or mechanical, without the permission of the copyright owner.

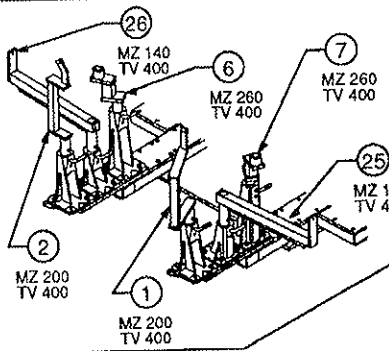



Choc avant sur chassis ou chassis plus caisse
Front crash on the frame or frame + car-body
Frontreparatur am Rahmen oder am kompletten Fahrzeug
Urto enteribre sul telaio + scocca
Choque delantero sobre chasis o chasis + caja

Voir feuille
See page
Siehe Blatt
Vedere pagina
Ver hoja

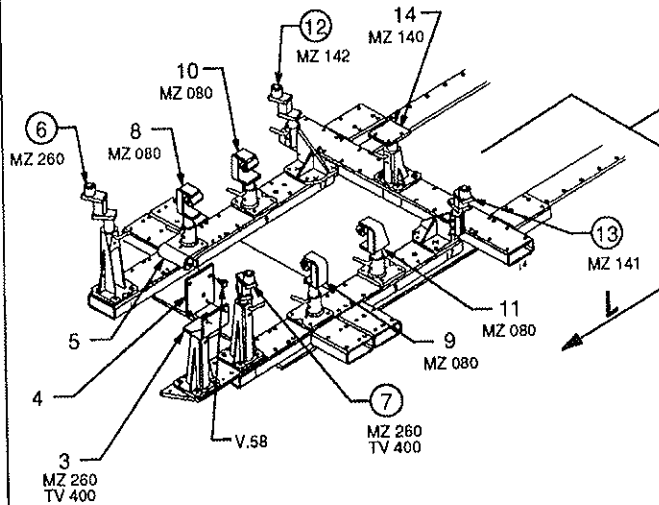

Choc avant sur chassis ou chassis plus caisse
Front crash on the frame or frame + car-body
Frontreparatur am Rahmen oder am kompletten Fahrzeug
Urto enteribre sul telaio + scocca
Choque delantero sobre chasis o chasis + caja

Voir feuille
See page
Siehe Blatt
Vedere pagina
Ver hoja

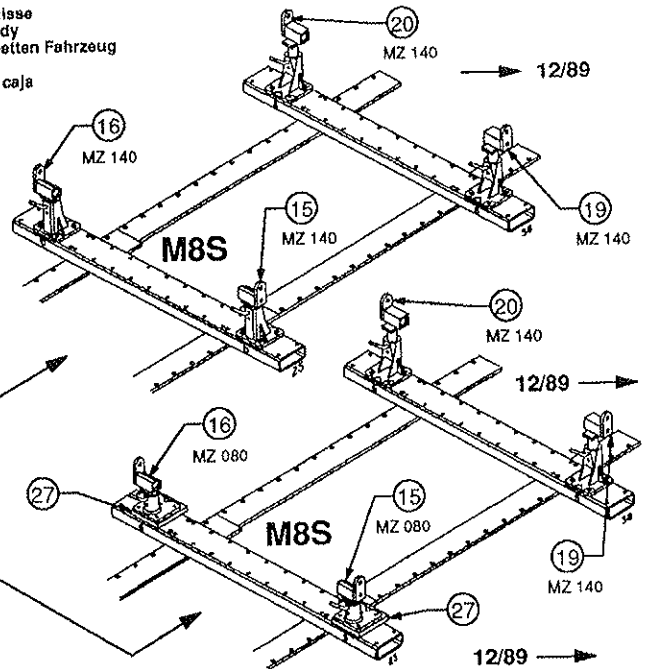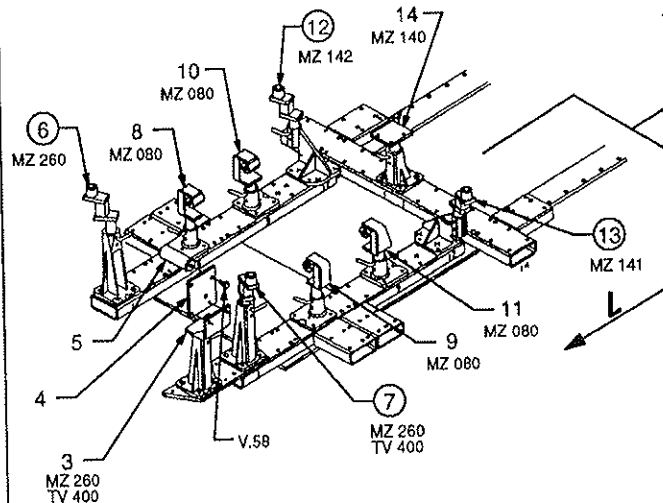


○ Avec ou sans mécanique
With or without mechanical elements
Con o senza parti meccaniche
Mit oder ohne Aggregate
Con ó sin mecánica desmontada

MERCEDES-BENZ

A partir du N° de chasis57303.
Ab chasis N°57303.

512.810		
● 512.809		
230 Kg	29.01.90	420-D-11 G

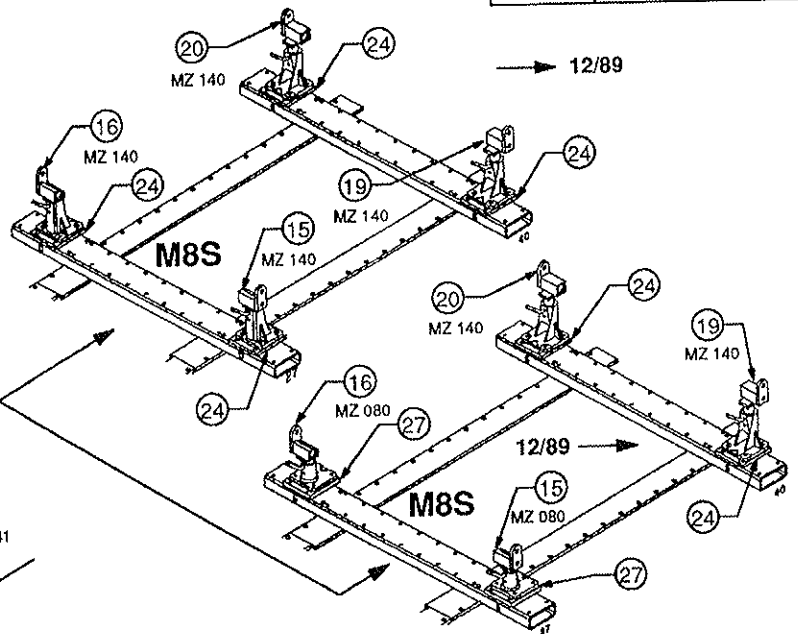


A partir du N° de chasis57303.
Ab chasis N°57303.

**CELETTE®****MERCEDES-BENZ****MB100 - MB100D - MB120 - MB140
MB160 - MB180**

Léger choc arrière avec mécanique arrière
Light rear crash with rear mechanical units in place
Leichter Heckshaden bei eingebauten Aggregaten (hinten)
Urto posteriore leggero con meccanica posteriore
Legero choque trasero con mecanica trasera montada

Voir feuille
See page
Siehe Blatt
Vedere pagina
Ver hoja

420-D-11H
(B 1-8)

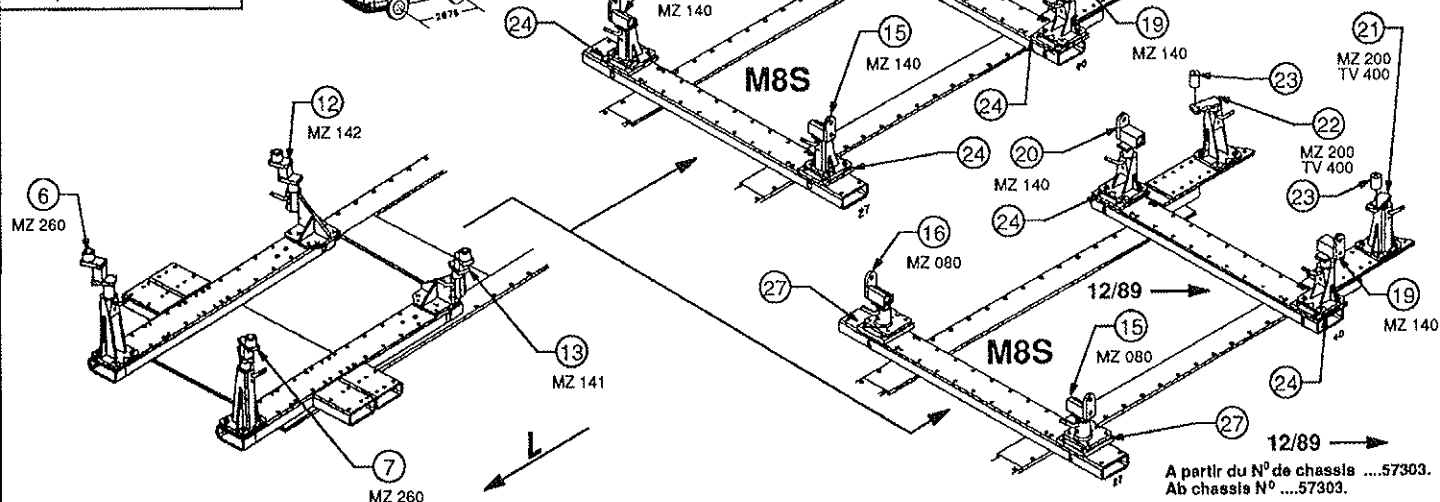

○ Avec ou sans mécanique
With or without mechanical elements
Con o senza parti meccaniche
Mit oder ohne Aggregate
Con ó sin mecanica desmontada

MERCEDES-BENZ**512.810****● 512.809**

230 Kg	29.01.90	420-D-11 R
--------	----------	------------

Léger choc arrière avec mécanique arrière
Light rear crash with rear mechanical units in place
Leichter Heckshaden bei eingebauten Aggregaten (hinten)
Urto posteriore leggero con meccanica posteriore
Legero choque trasero con mecanica trasera montada

Voir feuille
See page
Siehe Blatt
Vedere pagina
Ver hoja

420-D-11G
(B 1-8)

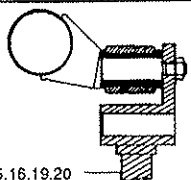
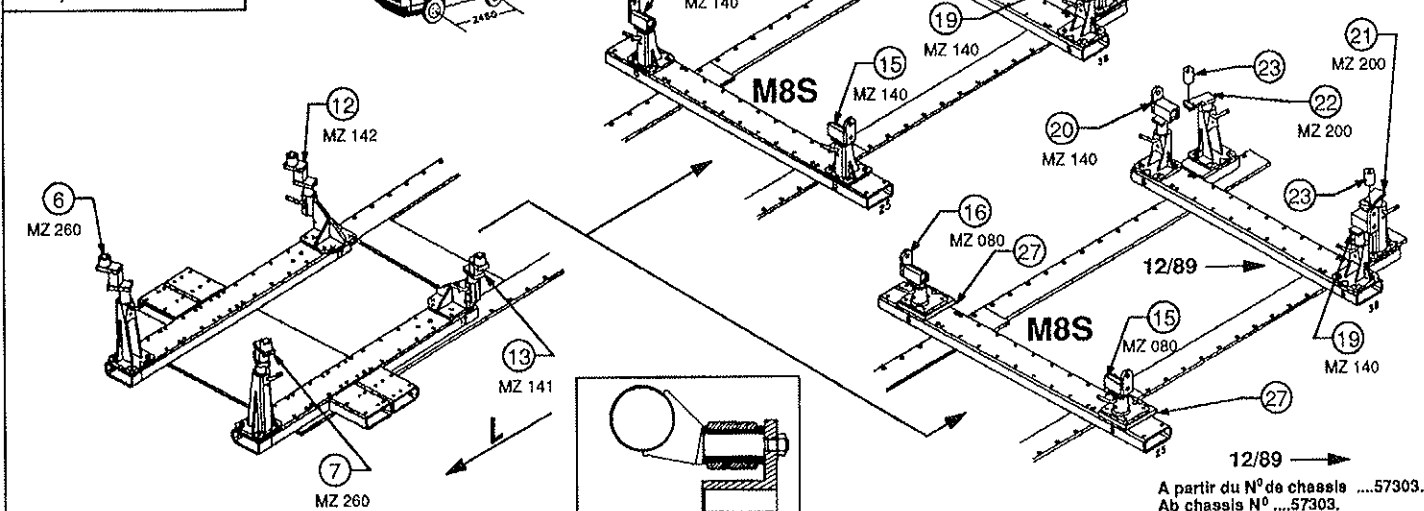


FIG. 2


A partir du N° de chassis57303.
Ab chassis N°57303.

CELETTE®
VIENNE-FRANCE

© Copyright 1990 CELETTE S.A. - All rights reserved. No part of this document may be reproduced in any form, by photostat, xerography or any other means, or incorporated into any informational retrieval system, electronic or mechanical, without the permission of the copyright owner.

Choc arrière sur châssis ou châssis plus caisse
Rear crash on the frame or frame + car-body
Heckreparatur am Rahmen oder am kompletten Fahrzeug
Urto posteriore sul telaio o telaio + scocca
Choque trasero sobre chasis o chasis + caja

Voir feuille
See page
Siehe Blatt
Vedere pagina
Ver hoja
420-D-11H
(B 1-8 oder E 1-5)

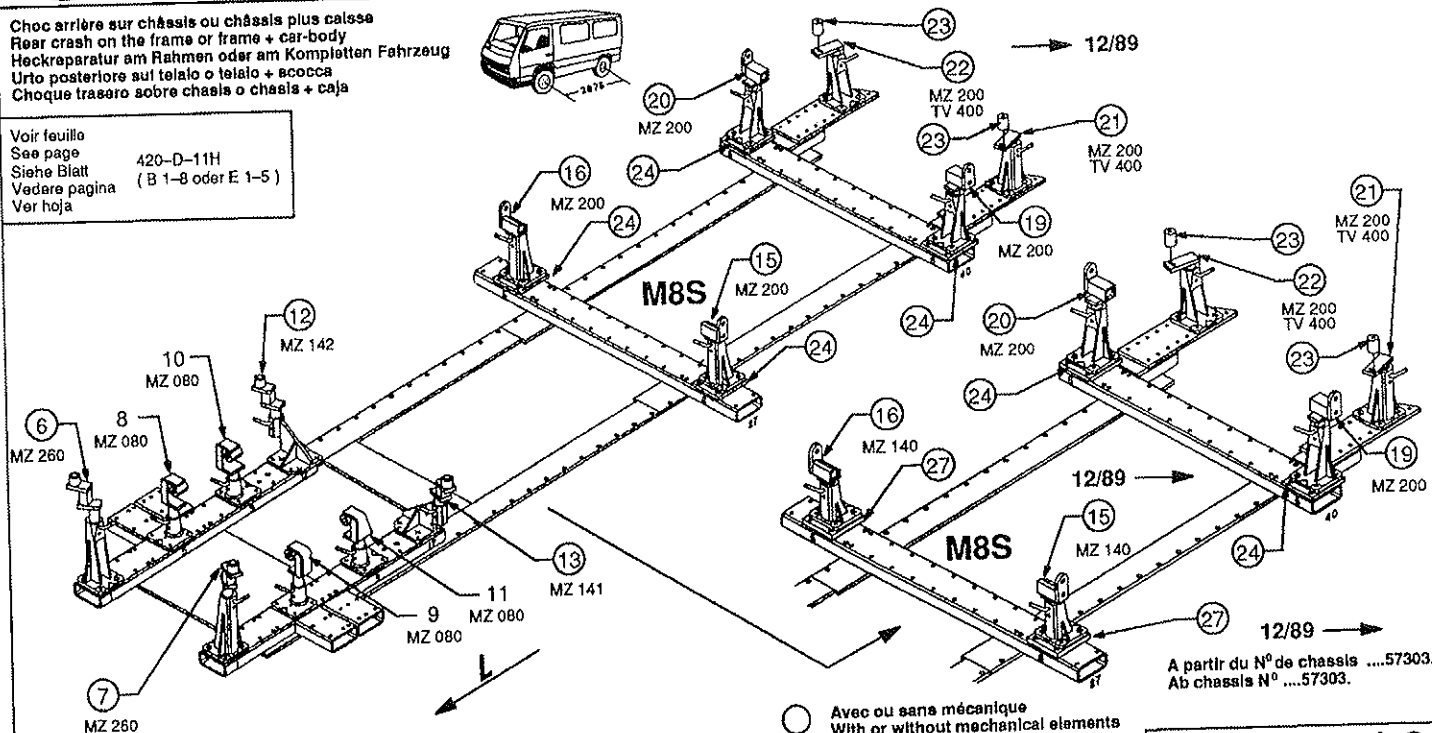

○ Avec ou sans mécanique
With or without mechanical elements
Con o senza parti meccaniche
Mit oder ohne Aggregate
Con ó sin mecánica desmontada

MERCEDES-BENZ


512.810

● 512.809

230 Kg 29.01.90 420-D-11 S

Choc arrière sur châssis ou châssis plus caisse
Rear crash on the frame or frame + car-body
Heckreparatur am Rahmen oder am kompletten Fahrzeug
Urto posteriore sul telaio o telaio + scocca
Choque trasero sobre chasis o chasis + caja

Voir feuille
See page
Siehe Blatt
Vedere pagina
Ver hoja
420-D-11G
(B 1-8 oder E 1-5)

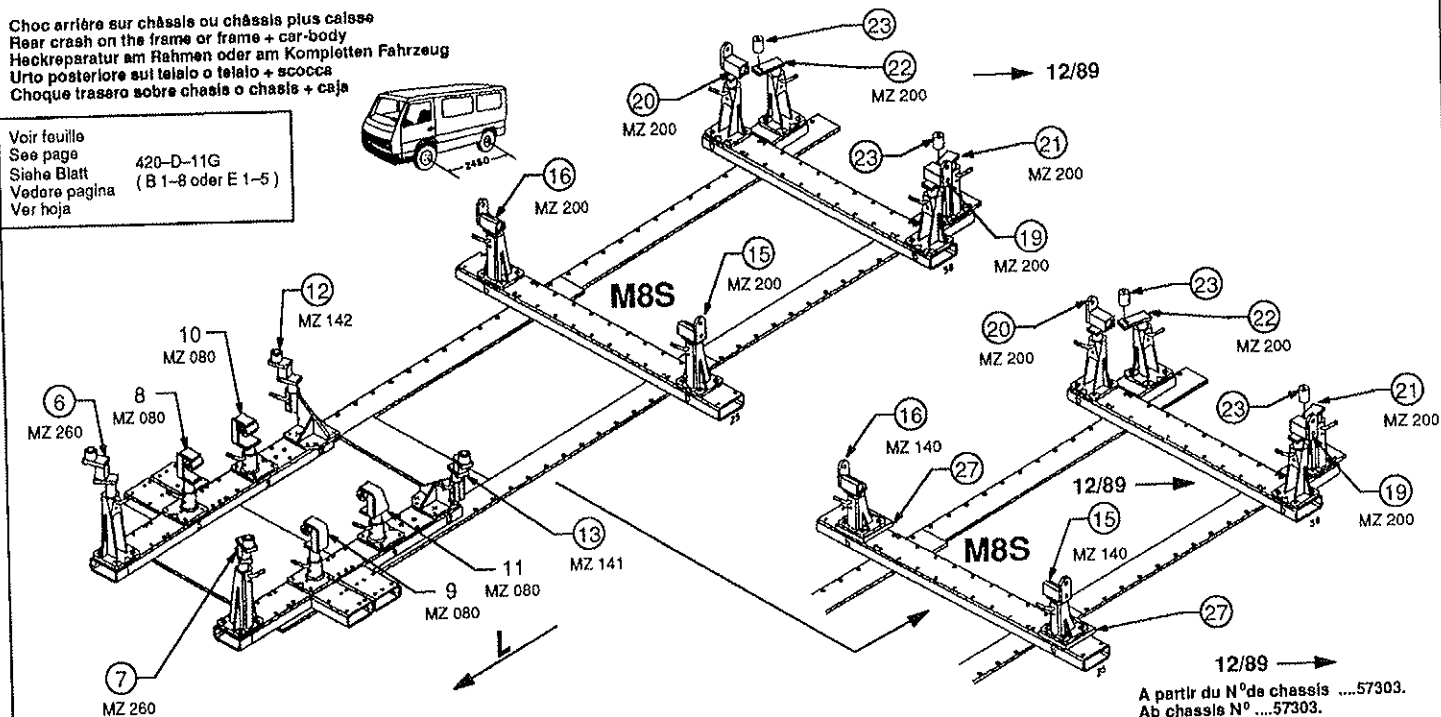

A partir du N° de châssis57303.
Ab chasis N°57303.